

Arc Ecology, et al. v. Maritime Administration, et al.

E.D. Cal. 2:07-cv-02320-GEB-KJN

Quarterly Status Report, Quarter ending March 31, 2013

The following Quarterly Status Report is provided in accordance with Section VI, Paragraph 7(a).

1. Number and description of SBRF non-retention vessels in the process, or to be included in the process, of acquiring drydocking, towing and recycling (or other) disposal services for the following quarter, which may result in the removal of the vessels depending on the availability and scheduling of industrial and other resources:

<u>Vessel</u>	<u>Scheduled Removal Date</u>
<i>Holland</i>	<i>To Be Determined (TBD)</i>
<i>Kansas City</i>	<i>TBD</i>
<i>Mount Hood</i>	<i>TBD</i>

2. SBRF non-retention vessels removed during the quarter ending March 31, 2013:

<u>Vessel</u>	<u>Disposition</u>	<u>Removal Date</u>
<i>Vancouver</i>	<i>Recycling</i>	<i>2/21/2013</i>
<i>Wichita</i>	<i>Recycling</i>	<i>3/6/2013</i>

3. **Description of exfoliating and exfoliated paint removal** for each Vessel that has been remediated in the preceding quarter and for each Vessel undergoing remediation at the time of this report; the status of removal of exfoliating and exfoliated paint and characterization, removal, storage, transportation and disposal of any hazardous waste associated with removal of such paint and debris.

- a. **Status of exfoliated paint removal:** During the quarter spanning 1 January through 31 March, exfoliated paint was removed from exterior horizontal surfaces of the ships listed in Table 1. The material removed included exfoliated paint, rust scale, corroded metal, bird waste, dust and miscellaneous debris. Methodology is/was pursuant to the SBRF SWPPP.

Vessel, Date of Completion
See Table 1

- b. **Status of exfoliating paint removal:** No activity for the reporting period.

Note: As of March 27, 2012, all MARAD Non-Retention vessels listed in Amended Exhibit A to the Consent Decree have been remediated of exfoliated and exfoliating paint above the waterline in compliance with paragraph 6(b)(2) of the Consent Decree.

- c. **Characterization** of any hazardous waste associated with removal of exfoliating and exfoliated paint: Exfoliated paint is managed as hazardous waste and subject to RCRA Subtitle C, California's HWCL, and implementing regulations. During this quarter, the Maritime Administration has performed no characterization that would support a determination that exfoliated paint is not hazardous waste. Prior to transportation and disposal, waste characterization for exfoliated paint removed was based on previous sampling data. This method was adopted to avoid duplication of cost/effort. Paint chips and debris had been analyzed during the initial sweeping phase and from the paint sampling and analysis accomplished in 2006 and 2010. All samples were characterized as hazardous waste and properly disposed.

- d. **Removal** of any hazardous waste associated with removal of exfoliating and exfoliated paint:
 - i. Exfoliated paint: All such hazardous waste was initially collected by shoveling, HEPA vacuuming and/or sweeping, then consolidated into five gallon buckets, hand-carried and emptied into 55-gallon reconditioned steel drums staged on one end of each vessel being cleaned.

 - ii. Exfoliating paint: No activity for the reporting period.

- e. **Storage** of any hazardous waste associated with removal of exfoliating and exfoliated paint:
 - i. Exfoliated paint: Filled drums (as described in section 3.d.i) were transported and stored in the SBRF parking lot under cover, pending disposal, in accordance with established BMPs.

 - ii. Exfoliating paint: No activity for the reporting period.

- f. **Transportation** of any hazardous waste associated with removal of exfoliating and exfoliated paint:
 - i. Exfoliated paint: Filled 55-gallon drums containing such waste were transported from vessels by crane barge to the pier, then fork-lifted to the parking lot where

they are stored under cover on pallets. Transportation to the disposal site was accomplished via contract, with pick-up being as needed.

ii. Exfoliating paint: No activity for the reporting period.

g. **Disposal** of any hazardous waste associated with removal of exfoliating and exfoliated paint:

i. Exfoliated paint: Drums containing such waste were disposed by contractor, Industrial Waste Utilization, Inc., with the waste being hauled to US Ecology, Beatty, NV (TSDF).

ii. Exfoliating paint: No activity for the reporting period.

4. **Vessel Condition Summary Report**. The Vessel Condition Summary Report for the preceding quarter is included as an attachment to this report.

5. **Hazardous Waste Manifests**. Copies of all hazardous waste manifests for any material disposed of during the preceding quarter from the SBRF are included as an attachment to this report.

Table 1, Status of Exfoliated Paint Removal, March 31, 2013

SHIP NAME	Twelfth Maintenance Sweep Due	Twelfth Maintenance Sweep Completed	# of Drums	Thirteenth Maintenance Sweep Due	Thirteenth Maintenance Sweep Completed	# of Drums	Fourteenth Maintenance Sweep Due	Comments
HASSAYAMPA	12/25/2012	12/20/2012	0.5	3/20/2013	3/19/2013	0.5	6/17/2013	Remediated by CCC
KAWISHIWI	1/1/2013	12/26/2012	0.5	3/26/2013	3/22/2013	0.5	6/20/2013	Remediated by CCC
PONCHATOULA	1/3/2013	12/31/2012	0.5	3/31/2013	3/28/2013	0.5	6/26/2013	Remediated by CCC
COMET	2/21/2013	2/20/2013	0.5	5/20/2013				Remediated by SBRF Crew
METEOR	2/25/2013	2/22/2013	0.5	5/22/2013				Remediated by SBRF Crew
MOUNT WASHINGTON	12/4/2012	11/29/2012	0.25	2/27/2013	2/25/2013	0.5	5/26/2013	Remediated by CCC
SHOSHONE	12/9/2012	12/6/2012	0.25	3/6/2013	3/1/2013	0.5	5/30/2013	Remediated by CCC
WILLAMETTE	12/11/2012	12/7/2012	0.25	3/7/2013	3/6/2013	0.5	6/4/2013	Remediated by CCC
MOUNT HOOD	12/16/2012	12/11/2012	0.25	3/11/2013	3/11/2013	0.5	6/9/2013	Remediated by CCC
WYMAN	4/16/2013							Remediated by CCC
CAPE BLANCO	5/12/2013							Remediated by SBRF Crew
NORTHERN LIGHT	5/5/2013							Remediated by CCC
CAPE BRETON	5/1/2013							Remediated by SBRF Crew
CAPE BORDA	4/25/2013							Remediated by SBRF Crew
KANSAS CITY	3/14/2013	3/13/2013	0.5	6/11/2013				Remediated by CCC
HOLLAND	3/17/2013	3/15/2013	0.5	6/13/2013				Remediated by CCC
VANCOUVER	3/19/2013	2/19/2013	0.75					Departed 2/21/13
WICHITA	3/1/2013	3/1/2013	0.25					Departed 3/6/13

RANK	SCORE	OVERALL RATING	SHIP NAME	PROGRAM	STATUS	LOCATION	HULL COND	HULL LEAKS	HULL PATCH	TOTAL OIL LT	TOPSIDE COND	PAINT	COVERAGE	INT COND	DISC RISK	HULL BLANKS	TCLP	YEAR BUILT	ENTERED FLEET	CONDITION REMARKS
1	2.55	YELLOW	USS NASSAU LHA-4	Custody Retention	NAVY	BRF	2	0	1	477.49	5	3	2	4	3	I	NO	1979	4/28/2011	DEACTIVATION COMPLETED
2	2.90	YELLOW	CAPE FLORIDA	Retention	Em. Sealift	BRF	5	0	0	1847.2	4	3	2	5	3	I	TBD	1971	10/11/2005	
3	3.00	YELLOW	VANGUARD	Non-Retention	Disposal	JRRF	5	0	0	0.0	2	2	2	4	4	I	Unk	1943	06/12/98	
4	3.00	YELLOW	HOLLAND	Non-Retention	Disposal	SBRF	5	0	0	0.0	2	2	2	3	4	X	Zn	1963	5/26/2000	ETD 5/31/13
5	3.05	YELLOW	CAPE JOHN	Non-Retention	Disposal	BRF	4	0	0	703.5	3	3	2	5	3	X	NO	1963	3/20/2004	
6	3.05	YELLOW	SIRIUS (AFS 8)	Non-Retention	Stripping	BRF	4	0	0	174.3	3	3	2	3	3	I	NO	1966	6/26/2009	Retention Temporary Fleet Use until completion Shore Side Transit Warehouse
7	3.10	YELLOW	IWMAN	Non-Retention	Disposal	SBRF	5	0	0	0.0	3	2	2	3	4	I	Zn	1971	3/26/2001	Remediation completed on-site by CCC on 11/15/11
8	3.12	YELLOW	MONONGAHELA	Non-Retention	Disposal	JRRF	5	0	0	3.5	4	1	3	4	2	I	Unk	1981	11/16/99	
9	3.12	YELLOW	PLATTE	Non-Retention	Disposal	JRRF	5	0	0	1.9	4	1	3	3	2	X	No	1983	07/14/99	
10	3.14	YELLOW	GULF TRADER	Non-Retention	Disposal	BRF	4	0	0	708.3	3	3	3	4	3	X	NO	1964	11/17/1997	DISPOSAL SITE INSPECTION CONDUCTED.
11	3.14	YELLOW	MERRIMACK	Non-Retention	Disposal	JRRF	5	0	0	1.6	4	1	1	4	4	I	Unk	1980	12/21/98	Departure expected summer 2013
12	3.24	YELLOW	YELLOWSTONE	Non-Retention	Disposal	SBRF	5	0	0	0.0	3	2	2	4	4	I	Unk	1980	04/06/00	
13	3.24	YELLOW	SHENANDOAH	Non-Retention	Disposal	JRRF	5	0	0	0.4	3	2	2	4	4	I	Unk	1983	11/02/00	
14	3.24	YELLOW	IRIS	Custody	USCG	SBRF	4	0	0	0.0	4	2	2	4	4	I	Zn	1943	8/8/1997	
15	3.24	YELLOW	PLANETREE	Custody	USCG	SBRF	4	0	0	0.0	4	2	2	4	4	I	Zn	1943	5/14/1999	
16	3.24	YELLOW	KANSAS CITY	Non-Retention	Disposal	SBRF	5	0	0	0.0	3	2	2	4	4	I	Pb	1969	9/2/1999	ETD 5/31/13
17	3.26	YELLOW	WILLAMETTE	Non-Retention	Disposal	SBRF	5	0	0	0.0	4	2	1	4	4	I	Zn	1980	6/22/1999	Remediation completed on-site by CCC on 9/15/11
18	3.29	YELLOW	CAPE MENDOCINO	Retention	Em Sealift	BRF	5	0	0	1196.4	5	3	3	3	4	X	TBD	1972	10/15/2011	
19	3.38	YELLOW	MOUNT HOOD	Non-Retention	Disposal	SBRF	5	0	0	168.7	4	2	2	4	4	I	Zn	1971	8/17/1999	ETD 5/31/13
20	3.43	YELLOW	CAPE FAREWELL	Retention	Mil. Useful	BRF	5	0	0	1885.5	5	3	3	5	4	NO	TBD	1973	6/16/2009	
21	3.43	YELLOW	CAPE FLATTERY	Retention	Mil. Useful	BRF	5	0	0	1431.3	5	3	3	5	4	NO	TBD	1973	7/20/2008	
22	3.48	YELLOW	KAWISHIWI	Non-Retention	Disposal	SBRF	5	0	0	216.7	4	3	2	4	4	I	Pb	1955	9/16/1992	Removed another 3,500 gal (12 LT) diesel for Fleet Craft use. More to be recovered.
23	3.48	YELLOW	PONCHATOLA	Non-Retention	Disposal	SBRF	4	0	0	93.1	4	3	2	4	4	NO	Zn	1955	4/2/1992	Contains diesel fuel recoverable by SBRF for Fleet Craft use. 22LT recovered Oct 2012.
24	3.57	GREEN	HARKNESS	Non-Retention	Log Supply	JRRF	5	0	0	93.6	3	3	3	3	4	I	No	1967	03/29/93	
25	3.62	GREEN	MHC-54 ROBIN	Custody Non-Retention	NAVY	BRF	5	0	0	2.1	4	3	2	5	3	I	TBD	1993	8/2/2006	
26	3.62	GREEN	FB-62	Retention	Fleet Supp	SBRF	4	0	0	0.0	4	3	2	4	4	X	Pb	1944	5/23/1962	Conducting topside coating maintenance aboard
27	3.62	GREEN	MOUNT WASHINGTON	Non-Retention	Disposal	SBRF	5	0	0	211.0	5	3	2	4	1	X	Zn	1963	6/2/2005	Remediation completed on-site by CCC on 9/18/11
28	3.62	GREEN	TRIUMPH	Retention	Log Supp	SBRF	5	0	0	50.2	5	3	3	4	2	I	Zn	1984	2/9/1996	
29	3.62	GREEN	HASSAYAMPA	Non-Retention	Disposal	SBRF	5	0	0	13.8	4	3	2	4	4	I	Pb	1955	11/14/1991	Remediation completed on-site by CCC on 3/25/2011
30	3.71	GREEN	EQUALITY STATE	Retention	Log Supp	BRF	5	0	0	662.3	5	4	3	4	4	I	NO	1962	12/13/2005	
31	3.76	GREEN	CHESAPEAKE	Retention	Log Supp	BRF	5	0	0	56.2	4	3	2	5	3	X	NO	1964	2/18/2009	
32	3.86	GREEN	TAVTS	Custody Retention	NAVY	BRF	5	0	0	0.0	5	4	3	N/A	5	N/A	TBD	2010	4/14/2010	
33	3.86	GREEN	CAPE ALEXANDER	Non-Retention	Disposal	JRRF	5	0	0	484.1	3	4	4	4	4	X	Unk	1962	04/01/80	
34	3.86	GREEN	SHOSHONE	Non-Retention	Disposal	SBRF	5	0	0	610.7	5	3	3	4	5	X	Pb	1957	9/30/1993	Remediation completed on-site by CCC on 9/11/11
35	3.90	GREEN	JAMES MCHENRY	Non-Retention	Disposal	JRRF	5	0	0	58.9	2	4	4	5	4	NO	No	1979	02/26/87	
36	3.90	GREEN	NORTHERN LIGHT	Non-Retention	Disposal	SBRF	5	0	0	3.0	5	3	2	4	4	X	Zn	1961	11/27/2000	Remediation completed on-site by CCC on 11/15/11
37	4.00	GREEN	CAPE GIBSON	Retention	Training	BRF	5	0	0	575.1	5	3	3	5	4	X	TBD	1968	4/4/2012	ARRIVED BRF 4/4/2012. DEACTIVATION IN FLEET UNDERWAY
38	4.00	GREEN	CAPE JOHNSON	Non-Retention	Disposal	JRRF	5	0	0	507.6	4	4	4	4	4	X	No	1962	02/26/87	Lifeboats to be removed prior to disposal activities
39	4.14	GREEN	CIN BARGE WITH D3 UNIT	Custody Retention	NAVY	BRF	5	0	0	0.0	5	5	4	NA	5	NA	TBD	2010	7/25/2010	
40	4.14	GREEN	CAPE LAMBERT	Retention	Em. Sealift	BRF	5	0	0	508.7	5	4	3	5	4	X	NO	1973	9/30/2008	
41	4.14	GREEN	CAPE LOBOS	Retention	Em. Sealift	BRF	5	0	0	412.7	5	4	3	5	4	X	NO	1972	9/29/2008	
42	4.14	GREEN	DIAMOND STATE	Retention	Log Supp	BRF	5	0	0	222.3	5	4	3	5	4	I	NO	1960	7/20/2006	
43	4.14	GREEN	CAPE JUBY	Retention	Log Supply	JRRF	5	0	0	631.7	5	4	4	5	4	X	No	1962	09/19/85	
44	4.19	GREEN	CAPE FEAR	Retention	Em. Sealift	SBRF	5	0	0	195.0	5	4	4	5	2	X	Pb	1971	7/19/2006	Contains diesel fuel recoverable by SBRF for Fleet Craft use
45	4.29	GREEN	CAPE VICTORY	RRF	ROS-5	BRF	5	0	0	703.0	5	5	4	5	5	NO	TBD	1984	7/10/2009	ROS-5 (10) Man Crew
46	4.29	GREEN	SAMUEL COBB	Retention	Interim Hold	BRF	5	0	0	262.5	5	4	4	5	3	X	TBD	1985	2/28/2011	CARGO TANKS PLACED UNDER DH
47	4.29	GREEN	CAPE JACOB	Retention	Em. Sealift	SBRF	5	0	0	238.0	5	4	3	5	4	X	TBD	1961	4/29/2011	Contains diesel fuel recoverable by SBRF for Fleet Craft use
48	4.43	GREEN	CAPE VINCENT	RRF	ROS-5	BRF	5	0	0	578.0	5	5	4	5	5	NO	TBD	1984	8/26/2009	ROS-5 (10) Man Crew
49	4.43	GREEN	RICHARD G. MATTHIENEN	Retention	Mil. Useful	BRF	5	0	0	172.61	5	4	4	5	3	X	TBD	1985	5/10/2011	CARGO TANKS PLACED UNDER DH
50	4.43	GREEN	PAUL BUCK	Retention	Interim Hold	BRF	5	0	0	50.6	5	4	4	5	3	X	TBD	1985	2/1/2011	CARGO TANKS PLACED UNDER DH
51	4.43	GREEN	CAPE NOME	Retention	Log Supply	JRRF	5	0	0	224.1	5	4	4	5	4	X	No	1969	12/03/87	
52	4.43	GREEN	CAPE ARCHWAY	Non-Retention	Disposal	JRRF	5	0	0	157.0	4	4	4	5	4	X	No	1963	04/02/80	
53	4.43	GREEN	CAPE AVINOF	Retention	Training Use	JRRF	5	0	0	57.3	4	4	4	5	4	X	Unk	1963	04/14/80	
54	4.43	GREEN	CAPE ANN	Retention	Training Use	JRRF	5	0	0	48.9	4	4	4	5	4	X	Unk	1962	03/19/80	
55	4.43	GREEN	CAPE ALAVA	Retention	Training Use	JRRF	5	0	0	37.4	4	4	4	5	4	X	No	1962	04/11/80	
56	4.43	GREEN	STORIS	Custody	USCG	SBRF	5	0	0	0.0	5	4	4	4	4	X	Pb	1942	6/12/2007	
57	4.43	GREEN	METEOR	Non-Retention	Hist Review	SBRF	5	0	0	226.7	5	4	4	5	4	X	Pb,Zn	1967	7/25/2006	Topside coating remediation completed by SBRF crew on 2/2/12
58	4.57	GREEN	GREEN MOUNTAIN STATE	Retention	Log Supp	SBRF	5	0	0	84.1	5	4	4	5	4	X	Cu	1965	8/2/2004	Crane Diesel genset is internally blanked
59	4.57	GREEN	CAPE BLANCO	Non-Retention	Disposal	SBRF	5	0	0	26.6	5	4	4	5	4	X	Zn	1965	3/27/2003	Topside coating remediation completed by SBRF crew on 11/4/11
60	4.57	GREEN	COMET	Non-Retention	Hist Review	SBRF	5	0	0	19.0	5	4	4	5	4	X	Zn	1958	7/26/2006	Topside coating remediation began by SBRF crew on 11/8/11
61	4.57	GREEN	CAPE BORDA	Non-Retention	Disposal	SBRF	5	0	0	14.8	5	4	4	5	4	X	Zn	1967	7/21/2003	Topside coating remediation completed by SBRF crew on 6/24/11
62	4.57	GREEN	CAPE BOVER	Retention	Log Supp	SBRF	5	0	0	14.3	5	4	4	5	4	X	Zn	1966	7/17/2003	
63	4.57	GREEN	CAPE BRETON	Non-Retention	Disposal	SBRF	5	0	0	3.3	5	4	4	5	4	X	Pb	1967	3/25/2003	Topside coating remediation & maintenance completed by SBRF crew on 6/27/11
64	4.71	GREEN	MHC-51 OSPREY	Custody Non-Retention	NAVY	BRF	5	0	0	0.8	5	5	4	5	5	I	TBD	1991	8/9/2006	
65	4.71	GREEN	MHC-58 BLACKHAWK	Custody Non-Retention	NAVY	BRF	5	0	0	0.0	5	5	4	5	5	I	TBD	1994	12/6/2007	
66	4.71	GREEN	MHC-62 SHRIKE	Custody Non-Retention	NAVY	BRF	5	0	0	0.0	5	5	4	5						

Key for Vessel Condition Report

BOLD RED: Indicates changes from previous report

HIGHLIGHTED YELLOW: Indicates missing data

TOTAL OIL= is the total of heavy oil + diesel fuel + lube oil

Non-Retention = MARAD vessels that no longer have a useful application and are pending disposition

Retention = MARAD vessels that are being preserved for federal agency programs

Custody = Vessels owned/sponsored by other government programs or agencies that are being maintained by MARAD in the NDRF on a reimbursable basis

Hull Leaks and Patches = when a leak is patched it is only shown as a patch. A ship with one leak that was patched will show "0" leaks and "1" patch. These do not affect the Condition Scores.

SORTING: Numerically descending based upon composite condition score.

Hull Condition Rating -

- 1** – Known holes exist in the underwater hull that may or may not be patched where the flooded parts of the vessel can be isolated and the potential for additional holes is deemed to be high.
- 2** – Known holes exist in the underwater hull that may or may not be patched where the flooded parts of the vessel can be isolated and the potential for additional holes is moderate.
- 3**–No known or suspected holes are in the underwater hull, the minimum hull scantlings are less than 25% of the classification society original hull thickness requirement, and the potential for the near-term development of holes is moderate.
- 4** – No known or suspected holes are in the underwater hull and the minimum hull scantlings are between 25% and 50% of the classification society original hull thickness requirement.
- 5**–No known or suspected holes are in the underwater hull and the minimum hull scantlings are between 50% and 100% of the classification society original hull thickness requirement.

Topside Condition Rating

- 1** – Many known or suspected holes exist in topside areas that leak major amounts of rainwater, which must be pumped frequently.
- 2** – Some known or suspected holes exist in topside areas that leak substantial amounts of rainwater, which must be pumped regularly.
- 3** – A small number of known holes in topside areas that leak rainwater, which must be pumped occasionally.
- 4** – No holes exist in topside areas and no pumping of water from the vessel is required beyond minor occasional bilge house keeping; however, some areas have severe deterioration as indicated by heavy rust and peeling paint.
- 5** – No holes exist in topside areas and no pumping of water from the vessel is required beyond minor occasional bilge house keeping and minor deterioration exists as indicated by slight rust and peeling paint.

Paint Condition

- 1** - At least 25% of paint has potential for exfoliation, or there is substantial accumulation of exfoliated paint on deck that has potential for being discharged into the water.
- 2** - Between 5% and 25% of paint has potential for exfoliation, or there is moderate accumulation of exfoliated paint on deck that has potential for being discharged into the water.
- 3** - Less than 5% of paint has potential for exfoliation.
- 4** - Paint is intact and within their service life condition.
- 5** - Paint is intact, in like-new condition.

Coating Coverage

- 1** - Major coating degradation exists where large areas of hull or topside steel and rust is visible.
- 2** - Moderate coating degradation exists where small areas of hull or topside steel or rust is visible.
- 3** - Minor coating degradation exists where rust is beginning to bleed through coatings as cracks and chips.
- 4** - Coatings are intact and within their service life condition.
- 5** - Coatings are intact, in like-new condition.

Interior Condition Rating

- 1** – Severe rainwater damage or there are spaces that are not safe to enter without personal protective equipment.
- 2** – Minor rainwater damage or there are spaces that are not normally configured because of equipment or vessel structures moved so normal passage ways are blocked or partially blocked.
- 3** – There is no rainwater damage but the potential for damage occurring is high or spaces have large amounts of debris that can't be cleaned by the fleet workforce.
- 4** – Interior spaces are sealed from the external atmosphere but humidity is not actively being lowered with a dehumidification system and spaces are free of debris.
- 5** - Interior spaces are sealed from the external atmosphere and humidity is actively being lowered with a dehumidification system and spaces are free of debris.

Discharge Risk Condition Rating

- 1 – High risk for or evident discharge; major remediation required.
- 2 – High risk for or evident discharge; minor remediation required.
- 3 – Low risk for discharge; major remediation required.
- 4 – Low risk for discharge; minor remediation required.
- 5 – Low risk for discharge; no remediation required.

CALCULATING THE CONDITION SCORE: The Condition Score is the average of the following seven component scores with each component being weighted appropriately. In essence it is found:

$$\text{Vessel Condition} = \frac{(\text{Hull} + \text{Oil} + \text{Topside} + \text{Paint} + \text{Coverage} + \text{Interior} + \text{Discharge Risk})}{7}$$

The Condition Score is on a scale of 0 to 5, where a score of 5 is best and 0 is worst.

HULL CONDITION SCORE: Hull condition ranges from 1 to 5, where hull the worst vessels are weighted heavier on the scale and is adjusted according to the presence and location of hull blanks. If there are no hull blanks, the hull condition is reduced by one point. If there are internal hull blanks the hull score is reduced by 0.5 points. If there are external hull blanks or no need for hull blanks (N/A) then the hull condition is not affected. After the hull score is adjusted for blanks, it is weighted on the lower end of the scale. Hull scores between 2 and 5 are not affected. A score greater than 1.0 but less than 2.0 is weighted by a factor of 1.5. A score less than 1.0 is weighted by a factor of 2.

TOTAL OIL SCORE: The Oil Ranking Factor shows how much oil is onboard a vessel, in LT. For the purpose of calculating the Condition Score, this value is reduced to a scale of 0 to 5. For all oil values at or above 1000LT, the value is 0; otherwise, in the range of 800 to 1000LT is 1, 600 to 800LT is 2 points, 400 to 600LT is 3 points, 200 to 400LT is 4 points and less than 200LT of oil is worth 5 points. Furthermore, the Oil Score is tied to the weighted Hull Condition Score. If a Hull Score is less than 2.0, the Oil Score is weighted by a factor of 1.5. A Hull Score of less than 1.0 affects the Oil Score by a factor of 2.

TOPSIDE CONDITION SCORE: Topside condition ranges from 1 to 5, where hull the worst vessels are weighted heavier on the scale. A rating of 5 is worth 5 points, 4 worth 4 points 3 worth 3, 2 worth 1.333 (2 weighted by a factor of 1.5) and 1 is worth 0.5 points (1 weighted by a factor of 2).

PAINT CONDITION SCORE: Paint condition ranges from 1 to 5, where hull the worst vessels are weighted heavier on the scale. A rating of 5 is worth 5 points, 4 worth 4 points 3 worth 3, 2 worth 1.333 (2 weighted by a factor of 1.5) and 1 is worth 0.5 points (1 weighted by a factor of 2).

COATING COVERAGE SCORE: Coating coverage ranges from 1 to 5, where hull the worst vessels are weighted heavier on the scale. A rating of 5 is worth 5 points, 4 worth 4 points 3 worth 3, 2 worth 1.333 (2 weighted by a factor of 1.5) and 1 is worth 0.5 points (1 weighted by a factor of 2).

INTERIOR CONDITION SCORE: Interior condition ranges from 1 to 5, where hull the worst vessels are weighted heavier on the scale. A rating of 5 is worth 5 points, 4 worth 4 points 3 worth 3, 2 worth 1.333 (2 weighted by a factor of 1.5) and 1 is worth 0.5 points (1 weighted by a factor of 2).

DISCHARGE RISK CONDITION SCORE: Discharge Risk condition ranges from 1 to 5, where hull the worst vessels are weighted heavier on the scale. A rating of 5 is worth 5 points, 4 worth 4 points, 3 worth 3, 2 worth 1.333 (2 weighted by a factor of 1.5) and 1 is worth 0.5 points (1 weighted by a factor of 2).

DETERMINING THE OVERALL RATING: The Overall Rating groups the vessels for easier condition identification. Any vessel with a Condition Score less than 2.5 is a RED vessel. Any vessel with a score between 2.51 and 3.499 is a YELLOW vessel. Any vessel with a score greater than or equal to 3.5 is a GREEN vessel.

ADDITIONAL COLUMNS:

TCLP - Indicates any exceedences of the Toxicity Characteristic Leaching Procedure tests. The presence of any heavy metals in notable quantities is shown in this column.

HULL BLANKS - Indicates the presence and configuration of hull blanks. X - External Blanks, I - Internal Blanks, NO - None Present, N/A - Not Applicable. **The presence of internal blanks reduces the Hull Condition by 0.5 points. The lack of hull blanks reduces the Hull Condition by 1 point. External hull blanks (or N/A where appropriate) do not affect the Hull Condition.**

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator ID Number C23690090571	2. Page 1 of 1	3. Emergency Response Phone 925-577-0573	4. Manifest Tracking Number 010417018 JJK		
5. Generator's Name and Mailing Address US DOT Maritime Suisun Bay Reserve Fleet 2595 Lake Herman Road Suisun, CA 94510 Joe Pecoraro (707) 745-0417 Generator's Phone:			Generator's Site Address (if different than mailing address) FEB 8 2013				
6. Transporter 1 Company Name PAPC Services, Inc.			U.S. EPA ID Number C236900164740		SUISUN BAY RESERVE FLEET		
7. Transporter 2 Company Name World Environmental & Energy			U.S. EPA ID Number C236900037283				
8. Designated Facility Name and Site Address Altamont Landfill 10840 Altamont Pass Road Livermore, CA 94581 (925) 455-7300 Facility's Phone:			U.S. EPA ID Number C236901382732				
GENERATOR	9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers		11. Total Quantity	12. Unit Wt./Vol.	
			No.	Type			
	K	FRIBLABLE ASBESTOS, 0, 10, 2012, 20, 550 RD 0A221: ASBESTOS 5.9. PK111	4	BA	1	Y	151
14. Special Handling Instructions and Additional Information Friable asbestos waste NAERG #171 PAPC Services, Inc. (925) 371-4610 EPA Region IX BAAQMD 939 Ellis Street, San Francisco, CA asbestos removal requirement 40CFR51 (bagged, sealed & labeled)							
15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent. I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.							
Generator's/Officer's Printed/Typed Name Joseph A. Pecoraro			Signature <i>[Signature]</i>		Month 1	Day 17	
16. International Shipments <input type="checkbox"/> Import to U.S. <input checked="" type="checkbox"/> Export from U.S.			Port of entry/exit: Date leaving U.S.:				
TRANSPORTER	17. Transporter Acknowledgment of Receipt of Materials						
	Transporter 1 Printed/Typed Name William M. Long			Signature <i>[Signature]</i>		Month 1	
	Transporter 2 Printed/Typed Name Tom Hopkins			Signature <i>[Signature]</i>		Month 1	
DESIGNATED FACILITY	18. Discrepancy						
	18a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection						
	18b. Alternate Facility (or Generator) U.S. EPA ID Number						
	Facility's Phone:						
	18c. Signature of Alternate Facility (or Generator) Month Day Year						
19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)							
20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a							
Printed/Typed Name Tom Hopkins			Signature <i>[Signature]</i>		Month 01	Day 31	

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator ID Number CA0900090871	2. Page 1 of 1	3. Emergency Response Phone 000-000-0000	4. Manifest Tracking Number 006155684 FLE	
5. Generator's Name and Mailing Address US DOT MARITIME TUNSON TAX RESERVE 2000 LANE SHERMAN ROAD GENEVIA, GA 30140				Generator's Site Address (if different than mailing address)		
Generator's Phone: 707 748-5604						
6. Transporter 1 Company Name INDUSTRIAL WASTE UTILIZATION, INC.				U.S. EPA ID Number CA0900050583		
7. Transporter 2 Company Name				U.S. EPA ID Number		
8. Designated Facility Name and Site Address US ECOLOGY HWY 95, 13 MILES SOUTH OF BEAUFORT BEAUFORT, NC 28503				U.S. EPA ID Number NC7520010000		
Facility's Phone: 800-339-3943						
9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers		11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes
		No.	Type			
X	1. PG, PA3077. Hazardous waste, solid, n.o.s. (Lead based paint chips), 9, PGIII	15	DM	2388	Dr	0003 181
	2.					
	3.					
	4.					
14. Special Handling Instructions and Additional Information 1) Lead base paint chips approval # 070128303-1091 98-1 15 X55g1						
15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent. I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.						
Generator's/Offeror's Printed/Typed Name Joseph A. Pecoraro				Signature 		Month Day Year 2 5 13
16. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____						
17. Transporter Acknowledgment of Receipt of Materials						
Transporter 1 Printed/Typed Name M. MANAMA, LARRY L.				Signature 		Month Day Year 2 5 13
Transporter 2 Printed/Typed Name				Signature		Month Day Year
18. Discrepancy						
18a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection						
Manifest Reference Number:						
18b. Alternate Facility (or Generator)				U.S. EPA ID Number		
Facility's Phone:						
18c. Signature of Alternate Facility (or Generator)				Month Day Year		
19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)						
1.	H132	2.		3.		4.
20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a						
Printed/Typed Name Mr. Farber				Signature 		Month Day Year 2 5 13

UNIFORM HAZARDOUS WASTE MANIFEST		1. Generator ID Number CA5690000571	2. Page 1 of 1	3. Emergency Response Phone No. 909-984-9954	4. Manifest Tracking Number 006155683 FLE		
5. Generator's Name and Mailing Address US DOT MARITIME SOILS DAY RESERVE 22ND LAKE HEMMAN ROAD BENICOLA, CA 94510 Generator's Phone: 707 745-5504				Generator's Site Address (if different than mailing address)			
6. Transporter 1 Company Name INDUSTRIAL WASTE UTILIZATION, INC.				U.S. EPA ID Number LA0980580293			
7. Transporter 2 Company Name				U.S. EPA ID Number			
8. Designated Facility Name and Site Address AA SYCOOL, LLC 1925 S. FACTOR AVE. YUMA, AZ 85365 Facility's Phone: 928-783-3678				U.S. EPA ID Number AZR000501510			
9a. HM	9b. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers		11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes	
		No.	Type				
	1. Non RCRA Hazardous waste solid (only bags/absorbents)	14	DM	2478	D	233	
	2.						
	3.						
	4.						
14. Special Handling Instructions and Additional Information 1) only bags/absorbents-approval # 818153-SEI 98-1 14 X5591							
15. GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent. I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.							
Generator's/Offeror's Printed/Typed Name Joseph A. Pecoraro				Signature 		Month Day Year 2 5 13	
16. International Shipments <input type="checkbox"/> Import to U.S. <input type="checkbox"/> Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____ Transporter signature (for exports only): _____							
17. Transporter Acknowledgment of Receipt of Materials Transporter 1 Printed/Typed Name MAMANAMA, LARRY L. Signature Month Day Year 2 5 13 Transporter 2 Printed/Typed Name Signature Month Day Year							
18. Discrepancy 18a. Discrepancy Indication Space <input type="checkbox"/> Quantity <input type="checkbox"/> Type <input type="checkbox"/> Residue <input type="checkbox"/> Partial Rejection <input type="checkbox"/> Full Rejection Manifest Reference Number: _____							
18b. Alternate Facility (or Generator)				U.S. EPA ID Number			
Facility's Phone: _____							
18c. Signature of Alternate Facility (or Generator)				Month Day Year			
19. Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)							
1.	2.	3.	4.				
1.	H1A1						
20. Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a Printed/Typed Name DENNIS W. ROSENBERG Signature Month Day Year 2 5 13							

UNIFORM HAZARDOUS WASTE MANIFEST	1. Generator ID Number CA5690090571	2. Page 1 of 1	3. Emergency Response Phone 909-984-9984	4. Manifest Tracking Number 006518407 FLE
----------------------------------	--	----------------	---	--

Generator's Name and Mailing Address S DOT MARITIME SUISUN BAY RESERVE 595 LAKE HERMAN ROAD ENEZIA, CA 94510	Generator's Site Address (if different than mailing address)
Generator's Phone: 707 745-5604	

Transporter 1 Company Name INDUSTRIAL WASTE UTILIZATION, INC.	U.S. EPA ID Number CAD980585293
--	------------------------------------

Transporter 2 Company Name	U.S. EPA ID Number
----------------------------	--------------------

Designated Facility Name and Site Address S ECOLOGY HWY 95, 11 MILES SOUTH OF BEATTY BEATTY, NV 89003	U.S. EPA ID Number
Facility's Phone: 800-239-3943	NVT330010000

1. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number, and Packing Group (if any))	10. Containers		11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	No.	Type					
1. RQ, NA3077, Hazardous waste, solid, n.o.s. (lead based paint chips), 9, PGIII	19	DM	3538	P	D008	181	
2.							
3.							
4.							

Special Handling Instructions and Additional Information
 1) lead base paint chips-approval # 070128303-1091

19X55 GAL

GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/packaged, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent. I certify that the waste minimization statement identified in 40 CFR 262.27(a) (if I am a large quantity generator) or (b) (if I am a small quantity generator) is true.

Generator's/Offeor's Printed/Typed Name Joseph A. Pecoraro	Signature 	Month 3	Day 20	Year 13
---	---------------	------------	-----------	------------

International Shipments Import to U.S. Export from U.S. Port of entry/exit: _____ Date leaving U.S.: _____

Transporter Acknowledgment of Receipt of Materials	Transporter 1 Printed/Typed Name TIBE McMANAMA	Signature 	Month 3	Day 20	Year 13
	Transporter 2 Printed/Typed Name	Signature	Month	Day	Year

Discrepancy

1. Discrepancy Indication Space Quantity Type Residue Partial Rejection Full Rejection

Manifest Reference Number: _____ U.S. EPA ID Number: _____

Alternate Facility (or Generator)	U.S. EPA ID Number
Facility's Phone	
Signature of Alternate Facility (or Generator)	Month Day Year

Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)			
2.	3.	4.	5.

Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 13a	Signature	Month Day Year
--	-----------	----------------

1. Generator ID Number CA5690090571	2. Page 1 of 1	3. Emergency Response Phone 909-984-9984	4. Manifest Tracking Number 006518403 FLE
---	--------------------------	--	---

Generator's Name and Mailing Address
3 DOT MARITIME SUISUN BAY RESERVE
295 LAKE HERMAN ROAD
ENEZIA, CA 94510

Generator's Site Address (if different than mailing address)

Generator's Phone: **707 745-5604**

Transporter 1 Company Name
INDUSTRIAL WASTE UTILIZATION, INC.

U.S. EPA ID Number
CAD980585293

Transporter 2 Company Name

U.S. EPA ID Number

Designated Facility Name and Site Address
A SYDCOL, LLC
925 S. FACTOR AVE.
UMA, AZ 85365

U.S. EPA ID Number
AZR000501510

Facility's Phone: **928-783-3676**

1. U.S. DOT Description (including Proper Shipping Name, Hazard Class, ID Number and Packing Group (if any))	10. Containers		11. Total Quantity	12. Unit Wt./Vol.	13. Waste Codes		
	No.	Type					
1. Non RCRA Hazardous waste solid (oily rags/absorbents)	7	DM		P	223		
2.							
3.							
4.							

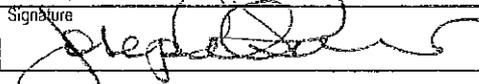
Special Handling Instructions and Additional Information
oily rags/absorbents-approval # S18153-SL1

7X556AL

GENERATOR'S/OFFEROR'S CERTIFICATION: I hereby declare that the contents of this consignment are fully and accurately described above by the proper shipping name, and are classified, packaged, marked and labeled/placarded, and are in all respects in proper condition for transport according to applicable international and national governmental regulations. If export shipment and I am the Primary Exporter, I certify that the contents of this consignment conform to the terms of the attached EPA Acknowledgment of Consent.

I certify that the waste minimization statement identified in 40 CFR 262.27(a) if I am a large quantity generator or (b) if I am a small quantity generator is true.

Generator's/Offerior's Printed/Typed Name
Joseph A. Pecoraro

Signature


Month Day Year
3 20 13

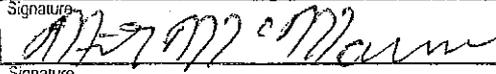
International Shipments Import to U.S. Export from U.S.

Port of entry/exit: _____

Date leaving U.S.: _____

Transporter Acknowledgment of Receipt of Materials

Transporter 1 Printed/Typed Name
MIKE McMANAMA

Signature


Month Day Year
3 20 13

Transporter 2 Printed/Typed Name

Signature

Month Day Year

Discrepancy

a. Discrepancy Indication Space Quantity Type Residue Partial Rejection Full Rejection

b. Alternate Facility (or Generator):

U.S. EPA ID Number

Facility's Phone:

c. Signature of Alternate Facility (or Generator):

Month Day Year

Hazardous Waste Report Management Method Codes (i.e., codes for hazardous waste treatment, disposal, and recycling systems)

2.	3.	4.
----	----	----

Designated Facility Owner or Operator: Certification of receipt of hazardous materials covered by the manifest except as noted in Item 18a

Printed/Typed Name

Signature

Month Day Year